



## Uneven Glove Box Fit: '01 Civic

On '01 Civics, the glove box may not fit evenly. To fix this problem, here's what you do:

1. Look at the glove box face, and note where the gaps appear uneven.
2. Remove the rubber stops inside the glove box, and lower it to access the frame bracket.

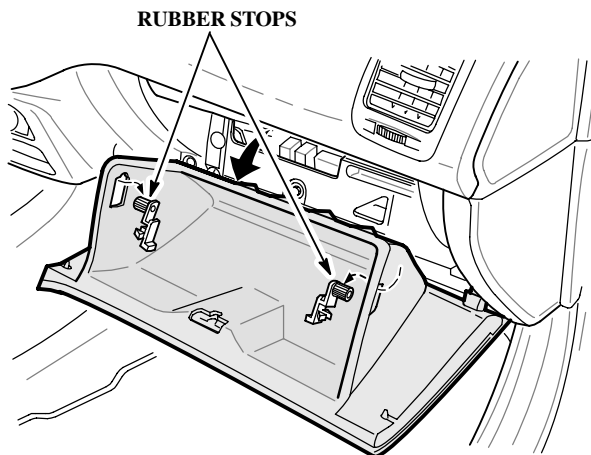

3. Loosen the five flange bolts on the bracket.

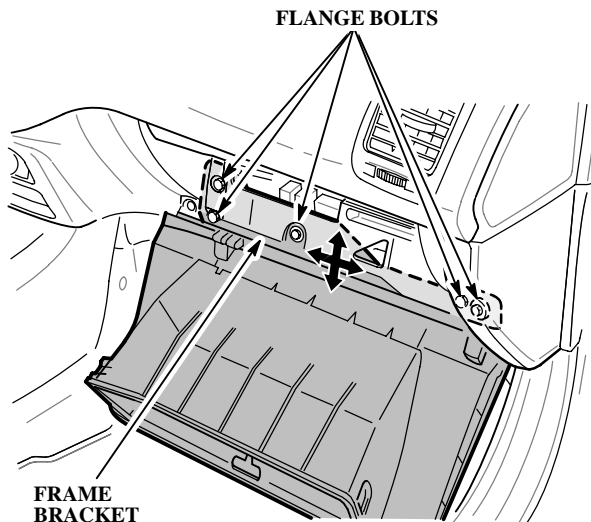

4. Shift the bracket in the direction needed to get the desired glove box fit.
5. Tighten a flange bolt on each end of the bracket, raise the glove box, and check if the gaps are even. If they're not, loosen the flange bolts, and repeat steps 4 and 5.
6. Once you get the desired fit, tighten the other flange bolts.
7. Raise the glove box, and reinstall the rubber stops.

## Which PGM Tester Software Should I Use?

The PGM Tester software for '01 models has been divided into three parts so it can be delivered before the new models arrive. Use this chart to determine which software version and program card you should use:

Version	Distribution	Description
SN120P	9/00 CD (9/14/00)	This is a preliminary version that strictly supports the Type 3 immobilizer system (all keys lost) on '01 Civics. Load it on a 4MB program card. If you have problems, call Special Tools at (800) 346-6327.
SN110	9/00 CD (9/14/00)	Supports all '01 models except Civics. Load it on an 8MB program card.
SN120	Scheduled for 11/00 CD	Will support <b>all</b> '01 models. Load it on an 8MB program card.

## Say "No" to Additives

Honda owner's manuals typically state: "Your Honda does not require any oil additives. Additives may adversely affect your engine's or transmission's performance and durability." These are **not** just idle words. American Honda did extensive testing, and found some popular ATF additives quickly degrade the shift quality of Honda transmissions. To help ensure your customers get the best performance possible from their Honda vehicles, urge them to take these words seriously, and say "no" to additives.

## Honda Cellular Telephone O/M Available

The Honda cellular telephone owner's manual for the '94-'97 Accord, '94-'97 Prelude, and the '95-'97 Odyssey has been reprinted and is now available. Order P/N 08E01-SV4-10081, H/C 4469904.

---

## Replacing the Rear Window: '00 S2000


On '00 S2000s, the replacement rear window kit (P/N 86317-S2A-003, H/C 6244537) contains these parts:

- One vinyl rear window
- One zipper pull
- Two zipper end stops
- Two 2-piece brass rivets (used to hold the bottom of the window to the roof)
- One neoprene strip (used to cover the outside of the zipper after the new window is installed)

What's **not** in the kit is the mounting hardware needed to attach the roof and the rear window to the rain rail. So, you'll need to purchase these items from a local hardware store:

- 3/16" x 1/2" aluminum pop rivets (8 required)
- 3/16" x 3/8" aluminum pop rivets (3 required)
- 3/16" aluminum washers (11 required)

You **must** install the pop rivets from inside the vehicle with the washer and the crush end of the rivet facing the rear of the vehicle. If the rivet's too long, the crush end will interfere with the body where the rain rail mounts. For complete installation instructions, see S/B 00-048, *Service Manual Update: Rear Window Replacement*, filed under Body.

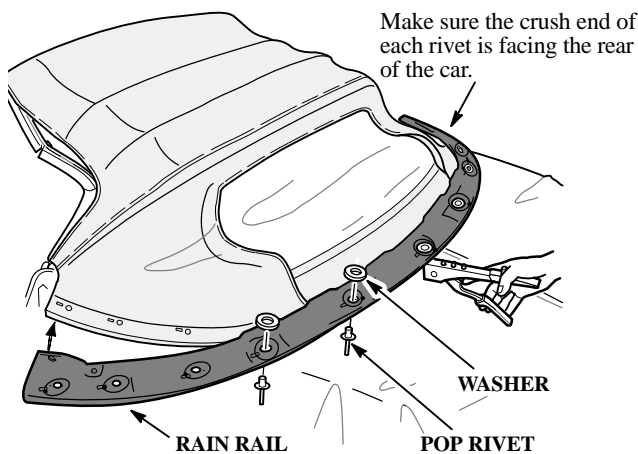

## Clock Light Doesn't Work: '00 Accord

On '00 Accords, if the back-light for the digital clock LCD doesn't work, replace the back-light bulb, **not** the digital clock assembly. Order this bulb: P/N 35505-S84-B02, H/C 5435540, or P/N 35505-S84-N01, H/C 5435557.

## Keyless Remote Won't Open Trunk: '00 Accord

On '00 Accords, if a replacement or third keyless remote transmitter locks and/or unlocks the doors but will **not** open the trunk, chances are it's a remote transmitter for a '98-99 Accord.

Although the remote transmitter for a '98-99 Accord looks identical to the one for a '00 model, it has a different part number and internal workings.

- The remote transmitter for the '00 Accord locks and unlocks the doors and unlocks the trunk on '98-00 Accords.
- The remote transmitter for the '98-99 Accord **will** lock and unlock the doors on a '00 Accord, but it will **not** unlock the trunk.

An easy way to tell which remote transmitter you have is to press the trunk release button and look at the LED. On a remote transmitter for a '00 Accord, the LED comes on in **0.5** second. On one for a '98-99 Accord, it comes on in **1.1** seconds.

## Nose Masks Can Cloud Paint

A nose mask can cloud a vehicle's paint if it's installed over a wet surface or if it gets wet and is not allowed to dry. Here are some important tips to remember when installing a nose mask on Honda vehicles:

- Make sure both the vehicle and the nose mask are clean and completely dry before you install the mask. If moisture under the nose mask is allowed to dry, it can cloud the paint.
- If the nose mask gets wet, take it off as soon as possible, and let it completely air-dry.
- Make sure any repainted surfaces the nose mask touches are cured.
- Make sure the hood and the nose of the vehicle are waxed with a high-quality paste wax.

This information is included in the installation instructions. Make sure you leave the installation instructions with your customer so they'll know how to install and remove the nose mask correctly and avoid damaging the paint.

## Powertrain DTC Quick Reference Chart

Here's a handy chart to help you find published service bulletins and ServiceNews articles with repair procedures for powertrain-related DTCs. When you have one of these vehicles with one of these codes, check the bulletin or article before you reach for the S/M. We'll update this chart periodically as new information becomes available.

Model	Year	DTC(s)	Repair Procedure Location
All Models	'96-00	P0700	S/N 4/98
Accord	'96-97	P1456, P1457	S/N 12/99
	'98-00	P1456, P1457	S/B 99-074
			S/B 99-075
		P1607	S/N 10/98
P1705, P1706	S/N 1/98		
Accord L4	'98-00	P0133	S/B 00-017
		P0171, P0172	S/B 00-018
		P1164	S/B 00-046
Accord V6	'98-99	P0304, P0306	S/B 99-066
		P0401	S/B 99-085
Civic EX	'98	P0133	S/B 99-049
Civic Si	'99-00		
Civic HX M/T	'98-00	P1163	S/B 00-028
Civic	'97	P0301, P0302, P0303, P0304	S/B 99-011
	'96-00	P0715, P0730	S/B 00-012
	'96-99	P1298	S/B 99-029
	'96-00	P1456, P1457	S/N 12/99
	'98-00	P1706	S/N 1/99
del Sol	'97	P0301, P0302, P0303, P0304	S/B 99-011
CR-V	'97	P0301, P0302, P0303, P0304	S/B 99-046
	'97-99	P0715, P0730	S/B 00-012
	'98-00	P1456, P1457	S/N 12/99
Odyssey	'99-00	P0401	S/B 00-009
		P0451	S/B 99-056
	'98-00	P1456, P1457	S/N 12/99
	'99-00	P1705	S/N 5/99

Model	Year	DTC(s)	Repair Procedure Location
Passport	'96-97	P0122, P1122, P1390, P1391, P1392, P1406	S/B 97-074
			P0300, P0301, P0302, P0303, P0304, P0305, P0306
		P1441	S/B 99-036
		'98-99	P1441
	'98-00	P0171, P0174, P1171	S/B 00-010
	'98	P0440, P0442	S/B 99-071
Prelude	'98-99	P0740	S/B 00-033
	'97-00	P1456, P1457	S/N 12/99

### Transfer Case Differences: '97-00 CR-V

The Automatic Transmission Remanufacturing (ATR) program shipped the wrong transfer case with some CR-V A/Ts. If the wrong transfer case is installed, the stiffener bracket will **not** fit. If you get a wrong transfer case, contact the ATR order desk at **(888) 997-7278**, and they'll send you the correct unit.

You can tell which transfer case is the correct one for the vehicle you're working on by the number of bolts on the front transfer case cover:

1997-98 CR-V models: Two bolts

1999-00 CR-V models: Four bolts

## Radio Repair Harness Saves Time and Money

When a radio is stolen, the thief often cuts the connector off the dashboard wire harness so the radio can be easily connected to another vehicle. This means added repair cost for the vehicle owner, since the dashboard wire harness must also be replaced as well as the radio itself.

To reduce repair costs, a short repair harness is available that eliminates the need to replace the dashboard wire harness (see chart below). It connects easily to the existing dashboard wire harness with solderless splice connectors available in terminal kit B (P/N 07QAZ-003020B, H/C 4733218). For the correct connector and wire color information, refer to the appropriate service manual or ETM. Each vehicle model can have different wire colors that may or may not match the repair harness.

Model	Year	Order Info	Pins
Accord	'86-97	P/N AE-94T91063F01 H/C 2647824	16
	'98-01	P/N 04320-S84-999AH H/C 6148233	20
Civic	'86-98	P/N AE-94T91063F01 H/C 2647824	16
	'99-01	P/N 04320-S84-999AH H/C 6148233	20
Prelude	'86-98	P/N AE-94T91063F01 H/C 2647824	16
	'99-01	P/N 04320-S84-999AH H/C 6148233	20
del Sol	'93-97	P/N AE-94T91063F01 H/C 2647824	16
Odyssey	'95-98	P/N AE-94T91063F01 H/C 2647824	16
	'99-01	P/N 04320-S84-999AH H/C 6148233	20
CR-V	'97-98	P/N AE-94T91063F01 H/C 2647824	16
	'99-01	P/N 04320-S84-999AH H/C 6148233	20
Passport	'94-95	P/N 2-91001-503-9 H/C 4519815	13
	'95.5-01	P/N 2-91101-801-0 H/C 5693783	16

## Insight IMA System Warranty Coverage

Because of their high cost, these components in the Integrated Motor Assist (IMA) system for '00-01 Insights are warranted for *8 years or 80,000 miles*, whichever comes first:

- Battery assembly
- Battery condition monitor module
- Battery electronic control unit
- DC-DC converter
- Motor electronic control unit
- Motor power inverter module
- Motor rotor
- Motor stator
- Predriver unit (motor driver module)



This warranty is in addition to the New Vehicle Limited Warranty and the Federal/California emissions warranties. The California warranty applies to vehicles registered and normally driven in California, Massachusetts, and Vermont.

## Install New Fuel Pump Gasket

On '99-01 Odysseys and '01 Civics, when working on an in-tank fuel pump unit, **always** make sure you install a new gasket. Place the new gasket on the tank first, then carefully insert the fuel pump unit. If you don't install the fuel pump correctly, the MIL can come on with a DTC P1456, EVAP Control System Leakage (fuel tank system).

## What's DTC P9999?

A bug in the PGM Tester software causes a DTC P9999 to be displayed when you're retrieving some DTCs. P9999 means an undefined code. To determine the DTC's identity, switch the PGM Tester to Generic OBD II mode. The Generic mode will show the correct SAE DTC.


HONDA ServiceNews


©2000 American Honda Motor Co., Inc. - All Rights Reserved. Published by AHM Service Publications, 1919 Torrance Blvd., Torrance, CA 90501-2746. All suggestions become the property of American Honda Motor Co., Inc.; sending a suggestion gives American Honda permission to publish it without further consideration.

WE SUPPORT  
VOLUNTARY TECHNICIAN  
CERTIFICATION THROUGH

National Institute for  
**AUTOMOTIVE  
SERVICE  
EXCELLENCE**

ASN 22226 (0010)