

Last Modified: 12-04-2024	6.11:8.1.0	Doc ID: RM100000028X1G
Model Year Start: 2023	Model: Prius Prime	Prod Date Range: [12/2022 -]
Title: BRAKE CONTROL / DYNAMIC CONTROL SYSTEMS: ELECTRONICALLY CONTROLLED BRAKE SYSTEM: C050062; Left Front Wheel Speed Sensor Signal Compare Failure; 2023 - 2024 MY Prius Prius Prime [12/2022 -]		

DTC	C050062	Left Front Wheel Speed Sensor Signal Compare Failure
------------	----------------	-------------------------------------------------------------

DESCRIPTION

Refer to DTC C050012.

Click here [INFO](#)

DTC NO.	DETECTION ITEM	DTC DETECTION CONDITION	TROUBLE AREA	MIL	DTC OUTPUT FROM	PRIORITY	NOTE
C050062	Left Front Wheel Speed Sensor Signal Compare Failure	Any of the following is detected: <ul style="list-style-type: none"> A lowest wheel speed is 10 km/h (6 mph) or more, the difference between the highest and lowest wheel speeds is 2 km/h (1 mph) or less, and the rotation direction of any one of the wheels is not detected for 15 seconds or more. A vehicle speed is 30 km/h (19 mph) or more and the rotation direction of one of the wheels is different from those of other 3 wheels as well as it is not detected for 1 second or more. 	Front speed sensor LH	Does not come on	Brake/EPB	B	Output ECU: No. 2 skid control ECU (brake actuator assembly)

PROCEDURE

1.	CHECK DTC
-----------	------------------

(a) Check the DTCs that are output.

Chassis > Brake/EPB > Trouble Codes

RESULT	PROCEED TO
Only C050062 is output	A
None of the above conditions are met	B

B ► REPAIR CIRCUITS INDICATED BY OUTPUT DTCS

A



2.	REPLACE FRONT SPEED SENSOR LH
-----------	--------------------------------------

HINT:

Click here

INFO

NEXT ► **END**

