12/16/24, 7:17 PM

HYBRID / BATTERY CONTROL: HYBRID CONTROL SYSTEM (for M20A-FXS): P0AD911; Hybrid/EV Battery Positive Contactor ...

Last Modified: 12-04-2024	6.11:8.1.0	Doc ID: RM100000028ZVF			
Model Year Start: 2023	Model: Prius Prime	Prod Date Range: [12/2022 -]			
Title: HYBRID / BATTERY CONTROL: HYBRID CONTROL SYSTEM (for M20A-FXS): P0AD911; Hybrid/EV Battery					
Positive Contactor Circuit Short to Ground; 2023 - 2024 MY Prius Prius Prime [12/2022 -]					

DTC

P0AD911 Hybrid/EV Battery Positive Contactor Circuit Short to Ground

DESCRIPTION

The SMRs (System Main Relays) are the relays that connect or disconnect the high-voltage system in accordance with commands from the hybrid vehicle control ECU.

There are 2 SMRs. SMRB and SMRG are located in the HV battery junction block assembly.

To shut off the high voltage power system, SMRB and SMRG are turned off.

DTC NO.	DETECTION ITEM	DTC DETECTION CONDITION	TROUBLE AREA	MIL	WARNING INDICATE	DTC OUTPUT FROM	PRIORITY	NOTE
P0AD911	Hybrid/EV Battery Positive Contactor Circuit Short to Ground	Short to ground in the SMRB circuit: Primary circuit of SMR (+) is malfunctioning. (2 trip detection logic)	 Wire harness or connector HV battery junction block assembly Hybrid vehicle control ECU 	Does not come on	Master Warning: Comes on	Hybrid Control	A	SAE Code: P0ADB

CONFIRMATION DRIVING PATTERN

HINT:

After repair has been completed, clear the DTC and then check that the vehicle has returned to normal by performing the following All Readiness check procedure.

Click here

- 1. Clear the DTCs (even if no DTCs are stored, perform the clear DTC procedure).
- 2. Turn the ignition switch off and wait for 2 minutes or more.
- 3. Turn the ignition switch to ON (READY) and wait for 30 seconds or more.
- 4. Turn the ignition switch off and wait for 2 minutes or more.
- 5. Enter the following menus: Powertrain / Hybrid Control / Utility / All Readiness.
- 6. Check the DTC judgment result.

HINT:

- If the judgment result shows NORMAL, the system is normal.
- If the judgment result shows ABNORMAL, the system has a malfunction.
- If the judgment result shows INCOMPLETE, perform driving pattern again.

12/16/24, 7:17 PM

HYBRID / BATTERY CONTROL: HYBRID CONTROL SYSTEM (for M20A-FXS): P0AD911; Hybrid/EV Battery Positive Contactor ...

WIRING DIAGRAM

Refer to the wiring diagram for the HV Battery High-voltage Line Circuit.

Click here

CAUTION / NOTICE / HINT

CAUTION:

Refer to the precautions before inspecting high voltage circuit.

Click here

NOTICE:

• After the ignition switch is turned off, there may be a waiting time before disconnecting the negative (-) auxiliary battery terminal.

Click here

· When disconnecting and reconnecting the auxiliary battery

HINT:

When disconnecting and reconnecting the auxiliary battery, there is an automatic learning function that completes learning when the respective system is used.

Click here

HINT:

If DTC P0AD911 is output, the ignition switch cannot be turned to ON (READY).

PROCEDURE

1. CHECK HARNESS AND CONNECTOR (HYBRID VEHICLE CONTROL ECU - BODY GROUND)

Pre-procedure1

(a) Disconnect the hybrid vehicle control ECU connector.

Procedure1

(b) Measure the resistance according to the value(s) in the table below.

Standard Resistance:

EWD INFO

Click Location & Routing(K11) Click Connector(K11)

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION	RESULT
K11-3 (SMRB) - Body ground	Ignition switch off	20.6 to 40.8 Ω	Ω

Post-procedure1

(c) Reconnect the hybrid vehicle control ECU connector.

OK > REPLACE HYBRID VEHICLE CONTROL ECU

Click here



2. CHECK CONNECTOR CONNECTION CONDITION (FLOOR WIRE CONNECTOR)

Click here

RESULT	PROCEED TO
ОК	А
NG (The connector is not connected securely.)	В
NG (The terminals are not making secure contact or are deformed, or water or foreign matter exists in the connector.)	

B CONNECT SECURELY

C REPAIR OR REPLACE HARNESS OR CONNECTOR



3.

CHECK HARNESS AND CONNECTOR (HYBRID VEHICLE CONTROL ECU - HV BATTERY JUNCTION BLOCK ASSEMBLY)

CAUTION:

Be sure to wear insulated gloves.


Pre-procedure1

(a) Check that the service plug grip is not installed.

NOTICE:

After removing the service plug grip, do not turn the ignition switch to ON (READY), unless instructed by the repair manual because this may cause a malfunction.

(b) Disconnect the HV battery junction block assembly connector.

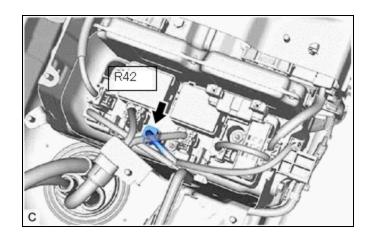

(c) Disconnect the hybrid vehicle control ECU connector.

Procedure1

(d) Measure the resistance according to the value(s) in the table below.

Standard Resistance:



<u>Click Location & Routing(K11,R42)</u> <u>Click Connector(K11)</u> <u>Click Connector(R42)</u>

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION	RESULT
K11-3 (SMRB) or R42-4 (SMRB) - Body ground and other terminals	Ignition switch off	$10~\text{k}\Omega$ or higher	kΩ

Post-procedure1

- (e) Reconnect the hybrid vehicle control ECU connector.
- (f) Reconnect the HV battery junction block assembly connector.

OK REPLACE HV BATTERY JUNCTION BLOCK ASSEMBLY

NG REPAIR OR REPLACE HARNESS OR CONNECTOR

ΤΟΥΟΤΑ

