Last Modified: 12-04-2024	6.11:8.1.0	Doc ID: RM1000000029BP7		
Model Year Start: 2023	Model: Prius Prime	Prod Date Range: [12/2022 -]		
Title: HYBRID / BATTERY CONTROL: MOTOR GENERATOR CONTROL SYSTEM (for M20A-FXS):				
P034016,,P034024; Camshaft Position Sensor "A" Circuit Bank 1 or Single Sensor Circuit Voltage Below				
Threshold; 2023 - 2024 MY Prius Prius Prime [12/2022 -]				

DTC	P034016	Camshaft Position Sensor "A" Circuit Bank 1 or Single Sensor Circuit Voltage Below Threshold
DTC	P034017	Camshaft Position Sensor "A" Circuit Bank 1 or Single Sensor Circuit Voltage Above Threshold
DTC	P034023	Camshaft Position Sensor "A" Circuit Bank 1 or Single Sensor Signal Stuck Low
DTC	P034024	Camshaft Position Sensor "A" Circuit Bank 1 or Single Sensor Signal Stuck High

DESCRIPTION

If the cam position signal pulse sent from the ECM via a direct line is abnormal, the motor generator control ECU (MG ECU) (built into the inverter with converter assembly) stores DTC P034016, P034017, P034023 or P034024.

DTC NO.	DETECTION ITEM	DTC DETECTION	TROUBLE AREA	MIL	WARNING INDICATE	DTC OUTPUT	PRIORITY	NOTE
		CONDITION				FROM		
P034016	Camshaft Position Sensor "A" Circuit Bank 1 or Single Sensor Circuit Voltage Below Threshold	GI signal (camshaft position sensor) is not input for 2 seconds or more while the engine is running* (1 trip detection logic)	SFI system Inverter with converter assembly ECM Wire harness or connector	Comes	Master Warning: Comes on	Motor Generator	А	SAE Code: P0342
P034017	1 or Single	GI signal (camshaft position sensor) is not input for 2 seconds or more while the engine is running*	 SFI system Inverter with converter assembly ECM Wire harness or 	Comes on	Master Warning: Comes on	Motor Generator	А	SAE Code: P0343

DTC NO.	DETECTION ITEM	DTC DETECTION CONDITION	TROUE	BLE AREA	MIL	WARNING INDICATE	DTC OUTPUT FROM	PRIORITY	NOTE
		(1 trip detection logic)		connector					
P034023	Camshaft Position Sensor "A" Circuit Bank 1 or Single Sensor Signal Stuck Low	GI signal (camshaft position sensor) is not input for 2 seconds or more while the engine is running* (1 trip detection logic)	•	SFI system Inverter with converter assembly ECM Wire harness or connector	Comes	Master Warning: Comes on	Motor Generator	A	SAE Code: P0342
P034024	Camshaft Position Sensor "A" Circuit Bank 1 or Single Sensor Signal Stuck High		•	SFI system Inverter with converter assembly ECM Wire harness or connector	Comes	Master Warning: Comes on	Motor Generator	Α	SAE Code: P0343

HINT:

MONITOR DESCRIPTION

If the motor generator control ECU detects a malfunction of the camshaft position sensor, it will illuminate the MIL and store a DTC.

MONITOR STRATEGY

Related DTCs	P0342 (INF P034016/P034023): Camshaft Position Signal (Drive Motor "A"/Generator) P0343 (INF P034017/P034024): Camshaft Position Signal (Drive Motor "A"/Generator)
Required sensors/components	Camshaft position sensor
Frequency of operation	Continuous
Duration	TMC's intellectual property
MIL operation	Immediately
Sequence of operation	None

^{*:} When this DTC is stored, vibration may occur when the engine is stopped.

TYPICAL ENABLING CONDITIONS

The monitor will run whenever the following DTCs are not stored	TMC's intellectual property	
Other conditions belong to TMC's intellectual property	-	

TYPICAL MALFUNCTION THRESHOLDS

TMC's intellectual property	-	
-----------------------------	---	--

COMPONENT OPERATING RANGE

Motor generator control ECU	DTC P0342 (INF P034016/P034023) is not detected
Motor generator control Eco	DTC P0343 (INF P034017/P034024) is not detected

CONFIRMATION DRIVING PATTERN

HINT:

- After repair has been completed, clear the DTC and then check that the vehicle has returned to normal by performing the following All Readiness check procedure.
 - Click here NFO
- When clearing the permanent DTCs, refer to the "CLEAR PERMANENT DTC" procedure.
 - Click here
 - 1. Clear the DTCs (even if no DTCs are stored, perform the clear DTC procedure).
 - 2. Turn the ignition switch off and wait for 2 minutes or more.
 - 3. Turn the ignition switch to ON (READY).
 - 4. With the vehicle stopped, move the shift lever to P.
 - 5. Depress the accelerator pedal to start the engine.
 - 6. Depress the accelerator pedal and maintain the engine speed at 1000 rpm or more for 5 seconds or more.

NOTICE:


As the state of charge of the HV battery may be low after driving in fail-safe mode, it will automatically be charged for 5 to 10 minutes with ignition switch ON (READY) after repairs have been performed.

- 7. Enter the following menus: Powertrain / Motor Generator / Utility / All Readiness.
- 8. Check the DTC judgment result.

HINT:

- If the judgment result shows NORMAL, the system is normal.
- If the judgment result shows ABNORMAL, the system has a malfunction.
- If the judgment result shows INCOMPLETE, perform driving pattern again.

<u>WIRING DIAGRAM</u>

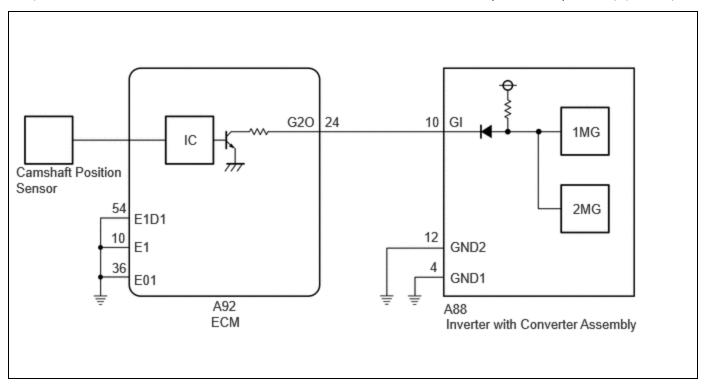

CAUTION / NOTICE / HINT

CAUTION:

Refer to the precautions before inspecting high voltage circuit.

Click here

NOTICE:

• After the ignition switch is turned off, there may be a waiting time before disconnecting the negative (-) auxiliary battery terminal.

Click here NFO

• When disconnecting and reconnecting the auxiliary battery.

HINT:

When disconnecting and reconnecting the auxiliary battery, there is an automatic learning function that completes learning when the respective system is used.

Click here NFO

HINT:

P034016, P034017, P034023 or P034024 may be stored due to a malfunction which also causes the DTCs in the table below to be stored. In this case, first troubleshoot the output DTCs in the table below. Then, perform a test to attempt to reproduce the problems, and check that no DTCs are output.

	RELEVANT DTC
P06B01C	Generator Control Module Position Sensor REF Power Source Circuit Voltage Out of Range
P06D61C	Generator Control Module Offset Power Circuit Voltage Out of Range
P0A1B1F	Generator Control Module Circuit Intermittent
P1C2B49	Drive Motor "A" Control Module A/D Converter Circuit Internal Electronic Failure
P1C2B1C	Drive Motor "A" Control Module A/D Converter Circuit Voltage Out of Range
P1CAD49	Drive Motor "A" Position Sensor Internal Electronic Failure

	RELEVANT DTC
P1CB038	Drive Motor "A" Position Sensor REF Signal Frequency Incorrect
P313487	Communication Error from Drive Motor "A" to Generator Missing Message
P313483	Communication Error from Drive Motor "A" to Generator Value of Signal Protection Calculation Incorrect
P313486	Communication Error from Drive Motor "A" to Generator Signal Invalid

PROCEDURE

1. CHECK DTC OUTPUT (ENGINE)

Pre-procedure1

(a) None

Procedure1

(b) Check for DTCs.

Powertrain > Engine > Trouble Codes

RESULT	PROCEED TO
SFI system DTCs are not output.	А
Any of the following DTCs are also output.	В

	RELEVANT DTC
P034011	Camshaft Position Sensor "A" Bank 1 or Single Sensor Circuit Short to Ground
P034015	Camshaft Position Sensor "A" Bank 1 or Single Sensor Circuit Short to Battery or Open
P034031	Camshaft Position Sensor "A" Bank 1 or Single Sensor No Signal

Post-procedure1

(c) Turn the ignition switch off.



Click here



2. CHECK CONNECTOR CONNECTION CONDITION (INVERTER WITH CONVERTER ASSEMBLY CONNECTOR)

Click here NFO

RESULT	PROCEED TO
ОК	А
NG (The connector is not connected securely.)	В
NG (The terminals are not making secure contact or are deformed, or water or foreign matter exists in the connector.)	С







3. CHECK CONNECTOR CONNECTION CONDITION (ECM CONNECTOR)

Click here

NG CONNECT SECURELY



4. CHECK HARNESS AND CONNECTOR (INVERTER WITH CONVERTER ASSEMBLY - ECM)

CAUTION:

Be sure to wear insulated gloves.

Pre-procedure1

(a) Check that the service plug grip is not installed.

NOTICE:

After removing the service plug grip, do not turn the ignition switch to ON (READY), unless instructed by the repair manual because this may cause a malfunction.

- (b) Disconnect the inverter with converter assembly connector.
- (c) Disconnect the ECM connector.

- (d) Connect the cable to the negative (-) auxiliary battery terminal.
- (e) Turn the ignition switch to ON.

Procedure1

(f) Measure the voltage according to the value(s) in the table below.

Standard Voltage:



Click Location & Routing(A88)

Click Connector(A88)

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
A88-10 (GI) - Body ground	Ignition switch ON	Below 1 V

NOTICE:

Turning the ignition switch to ON with the inverter with converter assembly connector and ECM connector disconnected causes other DTCs to be stored. Clear the DTCs after performing this inspection.

Pre-procedure2

(g) Turn the ignition switch off.

Procedure2

(h) Measure the resistance according to the value(s) in the table below.

Standard Resistance (Check for Open):



Click Location & Routing(A88,A92)

Click Connector(A88)

Click Connector(A92)

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
A88-10 (GI) - A92-24 (G2O)	Ignition switch off	Below 1 Ω

Standard Resistance (Check for Short):



Click Location & Routing(A88,A92)

Click Connector(A88)

Click Connector(A92)

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
A88-10 (GI) or A92-24 (G2O) - Body ground and other terminals	Ignition switch off	10 kΩ or higher

Post-procedure1

(i) Disconnect the cable from the negative (-) auxiliary battery terminal.

- (j) Reconnect the ECM connector.
- (k) Reconnect the inverter with converter assembly connector.

NG > REPAIR OR REPLACE HARNESS OR CONNECTOR




5. CHECK ECM

Pre-procedure1

(a) Disconnect the ECM connector.

Procedure1

(b) Measure the resistance according to the value(s) in the table below.

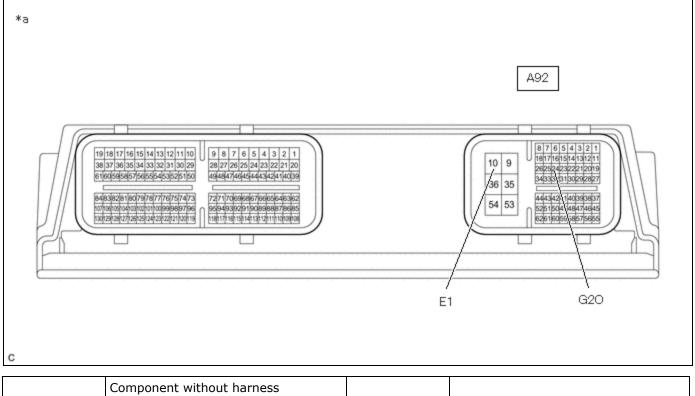

*a Component without harness connected - (ECM)

Standard Resistance:



<u>Click Location & Routing(A92)</u> <u>Click Connector(A92)</u> 12/16/24, 8:01 PM

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
A92-24 (G2O) - A92-10 (E1)	Ignition switch off 10 kΩ or higher	

Post-procedure1

(c) Reconnect the ECM connector.



NG > REPLACE ECM

Click here



