12/15/24, 11:22 AM


Last Modified: 12-04-2024	6.11:8.1.0	Doc ID: RM100000029GSU			
Model Year Start: 2023	Model: Prius	Prod Date Range: [12/2022 -]			
Title: NETWORKING: CAN COMMUNICATION SYSTEM (for HEV Model): Front Side Radar Sensor Communication					
Stop Mode; 2023 - 2024 MY Prius [12/2022 -]					

Front Side Radar Sensor Communication Stop Mode

DESCRIPTION

DETECTION ITEM	SYMPTOM	TROUBLE AREA
Front Side Radar Sensor Communication Stop Mode	Communication stop for "Front Side Radar "A"" is indicated on the "Communication Bus Check" screen of the GTS. Click here	 Front side radar sensor (A) branch line or connector Power source circuit of front side radar sensor (A) Front side radar sensor (A) ground circuit Front side radar sensor (A)

WIRING DIAGRAM

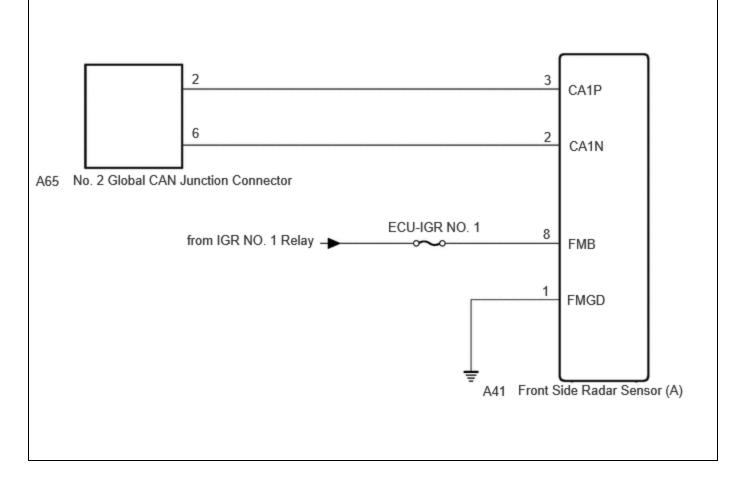

CAUTION / NOTICE / HINT

CAUTION:

When performing the confirmation driving pattern, obey all speed limits and traffic laws.

NOTICE:

• Because the order of diagnosis is important to allow correct diagnosis, make sure to begin troubleshooting using How to Proceed with Troubleshooting when CAN communication system related DTCs are output.

Click here

- Before measuring the resistance of the CAN bus, turn the ignition switch off and leave the vehicle for 1 minute or more without operating the key or any switches, or opening or closing the doors. After that, disconnect the cable from the negative (-) auxiliary battery terminal and leave the vehicle for 10 minutes or more before measuring the resistance.
- After the ignition switch is turned off, there may be a waiting time before disconnecting the negative (-) auxiliary battery terminal.

Click here

• When disconnecting and reconnecting the auxiliary battery.

HINT:

When disconnecting and reconnecting the auxiliary battery, there is an automatic learning function that completes learning when the respective system is used.

Click here

• Some parts must be initialized and set when replacing or removing and installing parts.

Click here

• After performing repairs, perform the DTC check procedure and confirm that the DTCs are not output again.

12/15/24, 11:22 AM NETWORKING: CAN COMMUNICATION SYSTEM (for HEV Model): Front Side Radar Sensor Communication Stop Mode; 2023...

DTC check procedure: Turn the ignition switch to ON and wait for 1 minute or more. Then operate the suspected malfunctioning system and drive the vehicle at 60 km/h (37 mph) or more for 5 minutes or more.

• After the repair, perform the CAN bus check and check that all the ECUs and sensors connected to the CAN communication system are displayed as normal.

Click here

• Inspect the fuses for circuits related to this system before performing the following procedure.

HINT:

- Before disconnecting related connectors for inspection, push in on each connector body to check that the connector is not loose or disconnected.
- When a connector is disconnected, check that the terminals and connector body are not cracked, deformed or corroded.

PROCEDURE

1.

CHECK FOR OPEN IN CAN BUS LINES (FRONT SIDE RADAR SENSOR (A) BRANCH LINE)

- (a) Disconnect the cable from the negative (-) auxiliary battery terminal.
- (b) Disconnect the A41 front side radar sensor (A) connector.
- (c) Measure the resistance according to the value(s) in the table below.

Standard Resistance:



<u>Click Location & Routing(A41)</u> <u>Click Connector(A41)</u>

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
A41-3 (CA1P) - A41-2 (CA1N)	Cable disconnected from negative (-) auxiliary battery terminal	54 to 69 Ω

NG REPAIR OR REPLACE CAN BRANCH LINES OR CONNECTOR (FRONT SIDE RADAR SENSOR (A))

OK

2. CHECK HARNESS AND CONNECTOR (POWER SOURCE CIRCUIT)

(a) Measure the resistance according to the value(s) in the table below.

Standard Resistance:



<u>Click Location & Routing(A41)</u> <u>Click Connector(A41)</u>

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
A41-1 (FMGD) - Body ground	Cable disconnected from negative (-) auxiliary battery terminal	Below 1 Ω

(b) Reconnect the cable to the negative (-) auxiliary battery terminal.

(c) Measure the voltage according to the value(s) in the table below.

Standard Voltage:



<u>Click Location & Routing(A41)</u> <u>Click Connector(A41)</u>

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
A41-8 (FMB) - Body ground	Ignition switch ON	11 to 14 V

OK REPLACE FRONT SIDE RADAR SENSOR (A)



NG REPAIR OR REPLACE HARNESS OR CONNECTOR (POWER SOURCE CIRCUIT)

TOYOTA

.