

<b>Last Modified:</b> 12-04-2024	6.11:8.1.0	<b>Doc ID:</b> RM100000029ZKS
<b>Model Year Start:</b> 2023	<b>Model:</b> Prius Prime	<b>Prod Date Range:</b> [12/2022 - ]
<b>Title:</b> M20A-FXS (ENGINE CONTROL): CAMSHAFT OIL CONTROL VALVE: ON-VEHICLE INSPECTION; 2023 - 2024 MY Prius Prius Prime [12/2022 - ]		

## ON-VEHICLE INSPECTION

### PROCEDURE

#### 1. REMOVE CAM TIMING OIL CONTROL SOLENOID ASSEMBLY

**HINT:**

[Click here](#) **INFO**


#### 2. INSPECT CAMSHAFT TIMING VALVE ASSEMBLY

(a) Check the stroke of the plunger in the center of the camshaft timing valve assembly.

Standard Stroke:

SPECIFIED CONDITION	RESULT
2.2 mm or higher	mm
0.0866 in. or higher	in.

If the result is not as specified, replace the camshaft timing valve assembly.

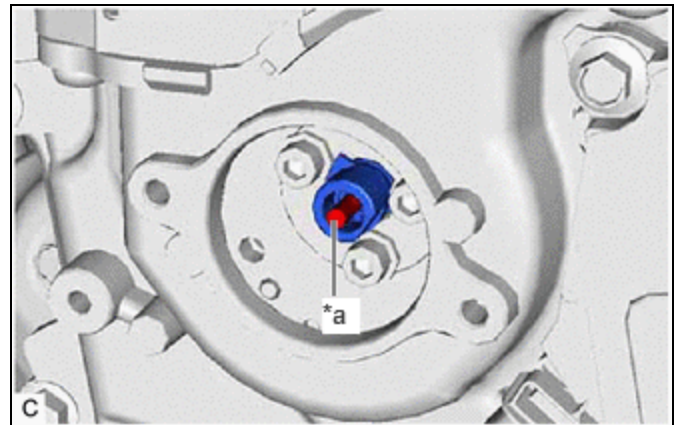

*a	Plunger
----	---------

#### 3. INSTALL CAM TIMING OIL CONTROL SOLENOID ASSEMBLY

**HINT:**

[Click here](#) **INFO**

