


Last Modified: 12-04-2024	6.11:8.1.0	Doc ID: RM100000029QF9
Model Year Start: 2023	Model: Prius Prime	Prod Date Range: [12/2022 -]
Title: EXTERIOR PANELS / TRIM: WHEEL OPENING MOULDING (for Rear Side): REMOVAL; 2023 - 2024 MY Prius Prius Prime [12/2022 -]		

REMOVAL

CAUTION / NOTICE / HINT

COMPONENTS (REMOVAL)

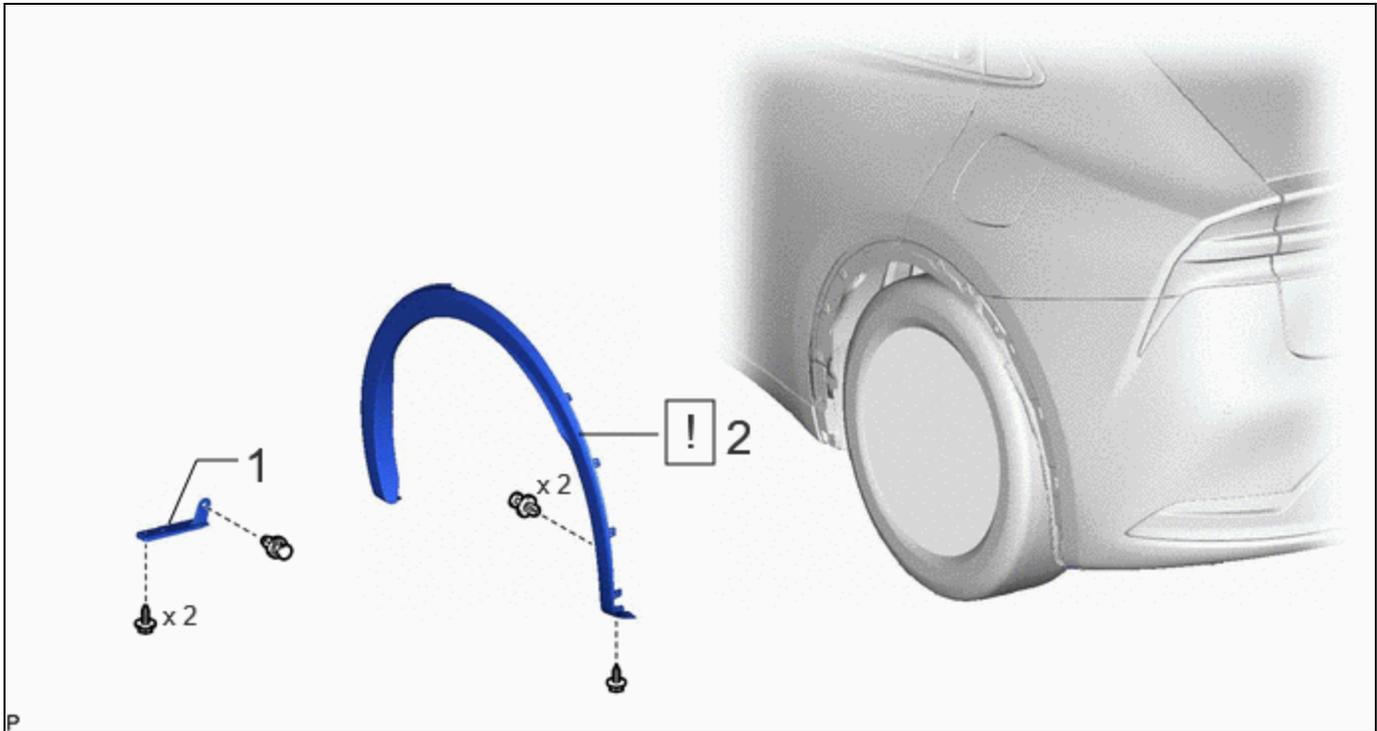


PROCEDURE		PART NAME CODE			
1	REAR WHEEL HOUSE FRONT PLATE	65632D	-	-	-
2	QUARTER OUTSIDE MOULDING SUB-ASSEMBLY	75606B	INFO	-	-

PROCEDURE

1. REMOVE REAR WHEEL HOUSE FRONT PLATE


Click here [INFO](#)

2. REMOVE QUARTER OUTSIDE MOULDING SUB-ASSEMBLY

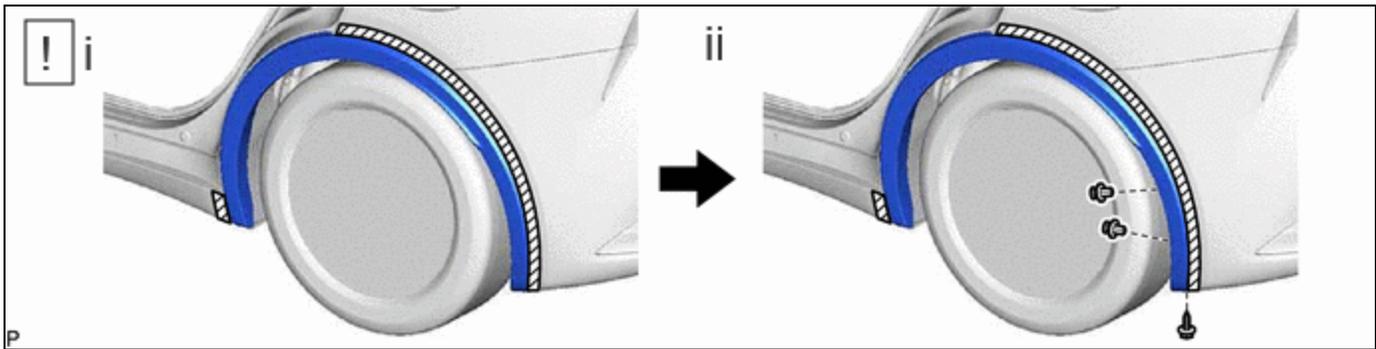

- (1) Apply protective tape around the quarter outside moulding sub-assembly as shown in the illustration.
- (2) Remove the 2 clips and screw.

(b) for LH Side:

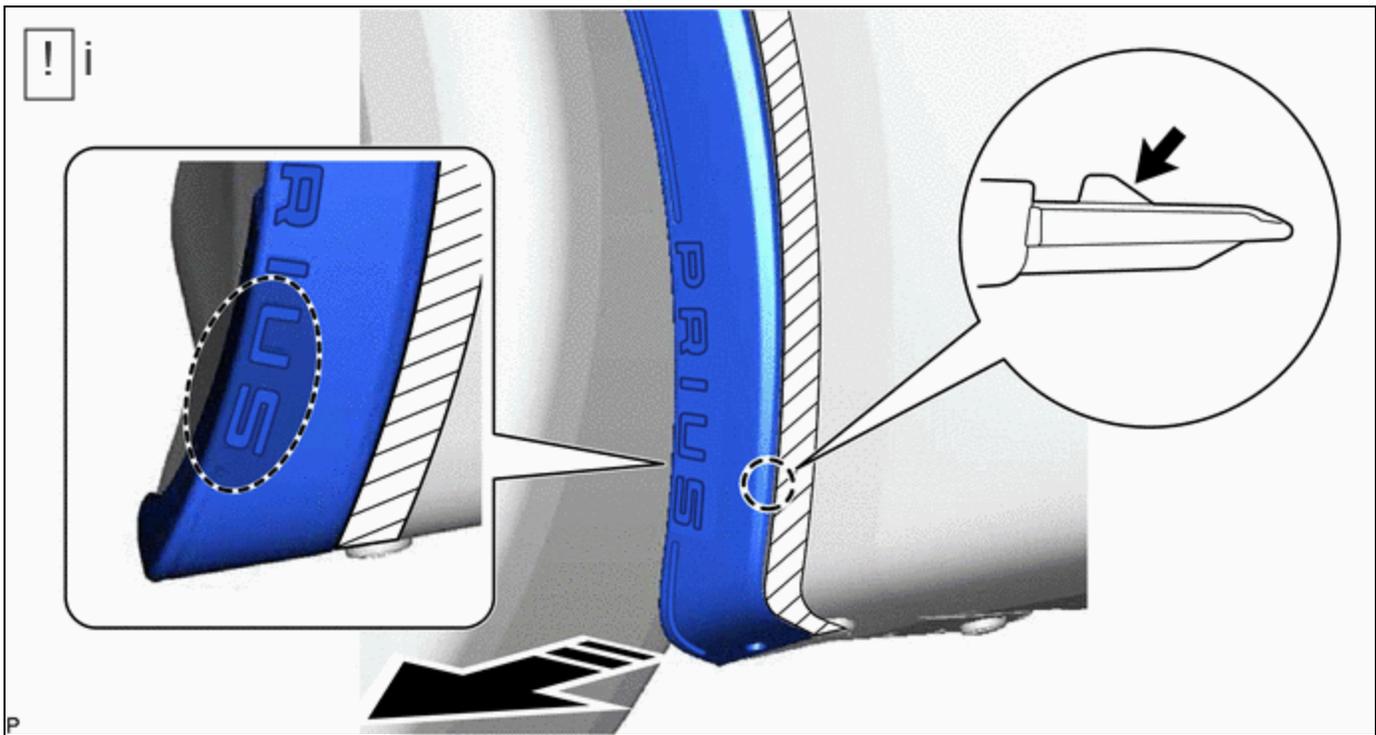


	Push		Place to Insert Hand
	Remove in this Direction	-	-

- (1) As shown in the illustration, insert your hand between the "U" and "S" of the "PRIUS" and directly push the claw to disengage it.

NOTICE:

In order not to damage the claw, pull the quarter outer side moulding carefully.

(c) for RH Side:

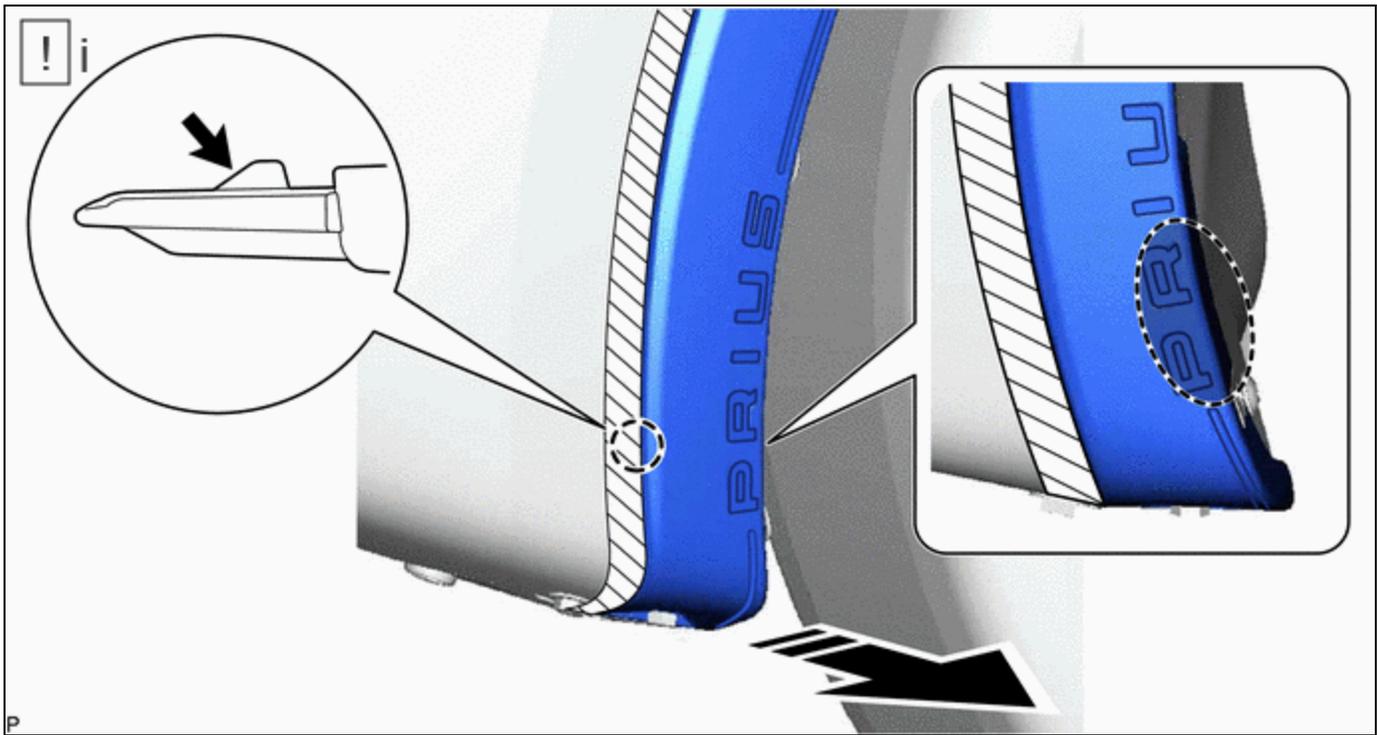


	Push		Place to Insert Hand
	Remove in this Direction	-	-

(1) As shown in the illustration, insert your hand between the "P" and "R" of the "PRIUS" and directly push the claw to disengage it.

NOTICE:

In order not to damage the claw, pull the quarter outer side moulding carefully.

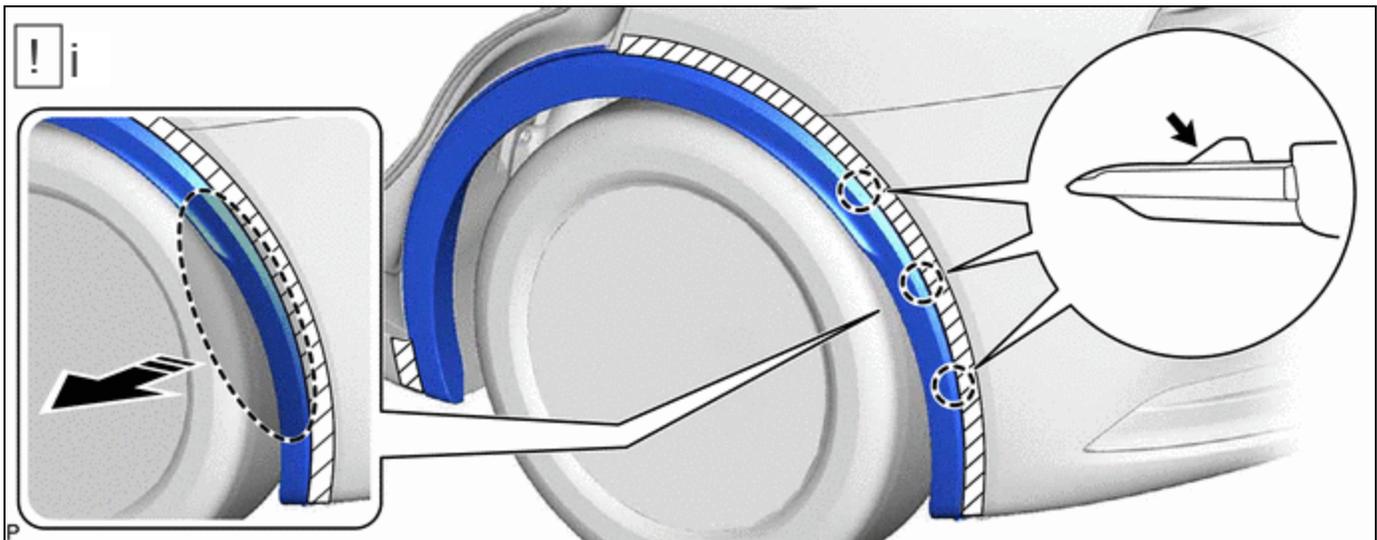


	Push		Place Hand Here
	Remove in this Direction	-	-

(1) Disengage the 3 claws by pushing the area indicated by the arrow in the illustration with a finger.

NOTICE:

To avoid damaging the claws, do not forcibly pull the quarter outside moulding sub-assembly.

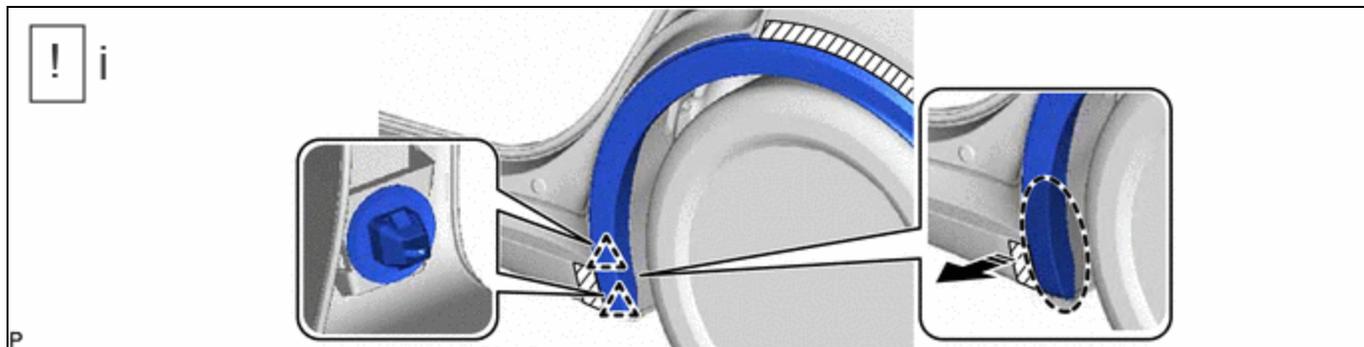


	Place Hand Here		Remove in this Direction
--	-----------------	--	--------------------------

(1) Disengage the 2 clips as shown in the illustration.

NOTICE:

To prevent damage to the clips, make sure to pull the quarter outer side moulding evenly and straight.

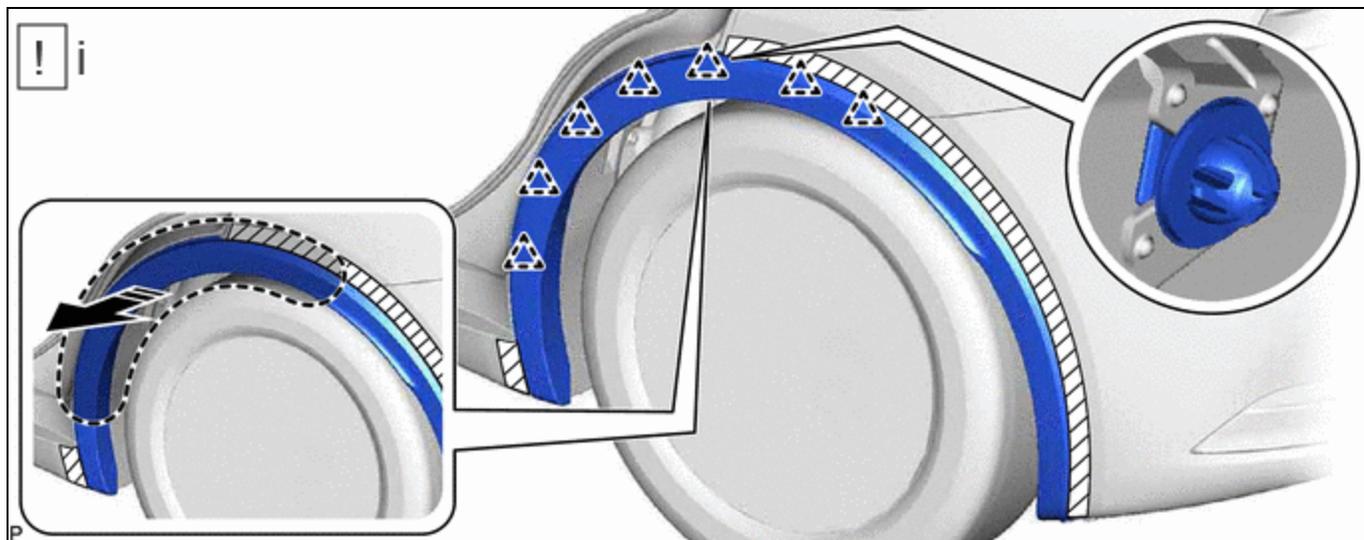

	Place Hand Here		Remove in this Direction
---	-----------------	---	--------------------------

(1) Disengage the 7 clips as shown in the illustration to remove the quarter outside moulding sub-assembly.

